TECHNICAL BULLETIN

Yaesu U.S.A.-Amateur Products Division - Technical Support

File No.: TB-9606A	1 of 3) Date: May 31, 1996	
Model: FT-1000MP	Scrint No. Range:	Il problem units.

Problem: Antenna won't tune on 15 meter band.

Expected Results of Modification: Improve Circuit.

	Component	Value Changes: Main	Unit
Part Location No.	From	To	New Part No.
RF UNIT			
L1086	L0021833A	L0021221	
L1087	L0022217	L0021222	

	ted Component: Mai	
Part Location Device 1		

Proc	edure
See below. (NOTE: You will need stick	on copper tape for this modification)
The second services of	at copper tape for this invalidation)

- 1. Remove top & bottom covers.
- 2. Remove the 2 screws from the left side of radio holding PA Unit and the 2 screws securing the PA Unit on the right side.
- 3. Remove 2 screws securing the fan in place to allow removal of PA Unit.
- 4. Lift out the PA Unit and lay over to the right side. Do not put too much strain on the cables and wiring harnesses.
- 5. You now have access to the RF Unit. Toward the front/left of the RF Unit you will see the BPF UNIT (large shielded enclosure with cover) and in fron of that you will see the a smaller shielded enclosure with no cover.
- 6. Solder a piece of copper braid between the BPF UNIT and the small enclosure as shown in the pictorial.
- 7. Following the pictorial, You will add stick on copper tape to the bottom of the PA UNIT where the spring contacts (2 of them) on the RF UNIT come in contact with the bottom of the PA UNIT. (Spring contact on small enclosure does not need copper tape).
- 8. Following the pictorial, add a stick on piece of copper tape to the left side of the PA UNIT to improve the bond to chassis ground.
- 9. Following the pictorial, use cable ties to tie the 2 cables by the small shielded enclosure and dress them to the side of the enclosure.
- 10. Remove L1086 & L1087 and replace with part numbers listed above.
- 11. Reassemble radio and test for correct operation.

MODIFICATION COMPLETE


TECHNICAL BULLETIN


100


Yaesu U.S.A - Amateur Products Division - Technical Support

File No.: TB-9606A (2 of 3) Date: May 31, 1996

Model: FT-1000MP Serial No. Range: All problem units.

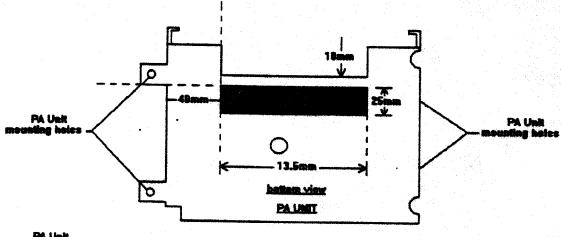

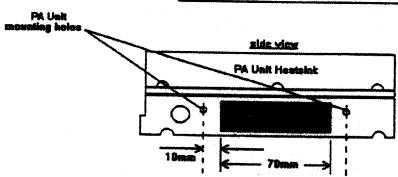

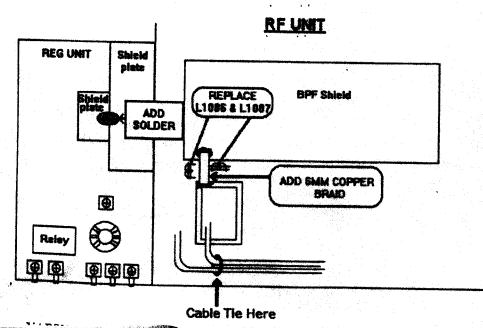

TECHNICAL BULLETIN

Yacsu U.S.A.-Americar Products Division - Technical Support

File Ne.: TB-9606/	A (3 of 3) Date:	May 31, 1996
Medel: FT-1000k	AP Seitel N	o. Range: All Problem Units

RF-UNIT/REG-UNIT Copper spring contact BPF Copper spring contact Copper spring contact FEG-UNIT REG-UNIT ADD TIE VISUAL TO REG-UNIT Copper spring contact Copper spring conta

NEW COIL MOUTING DETAIL

L1086 - L1087







SEND LEADS STRINGHT DOWN
AND AT RIGHT ANGLES