

TECHNICAL BULLETIN

Yaesu U.S.A. - Amateur Products Division - Technical Support

File No.:	TB-9623 (1 of 2)	Date:	6-24-96
Model:	FT-1000MP	Serial No. Range:	Problem Unit

Problem:	Keyer IAMBIC 2, having problem
----------	--------------------------------

Expected Results of Modification:	Improve circuit performance #2
-----------------------------------	--------------------------------


Component Changes: Control Unit			
Part Location No.	From	To	New Part No.
C5084	K46120002	Replace	K46120005
R5131	100ohms	22ohms	J01225220
Resistor	ADD	3.3Kohms	J01225332

Top cover removal (Technical Supplement Page # 2-1)

Turn the transceiver off, and disconnect all cables. Remove the 9 screws affixing the top cover, then tilt and pull the cover off. This exposes the ALC and ANT Units. (Removing the top cover; remove 3 screws on back cover near top, 3 screws on the right side and 3 screws on the left side.)

Bottom cover removal (Technical Supplement Page #2-2)


With the top cover off, remove the 7 screws affixing the bottom cover, then tilt and pull the cover off. This exposes the IF, AF, and CNTL units on the bottom chassis.

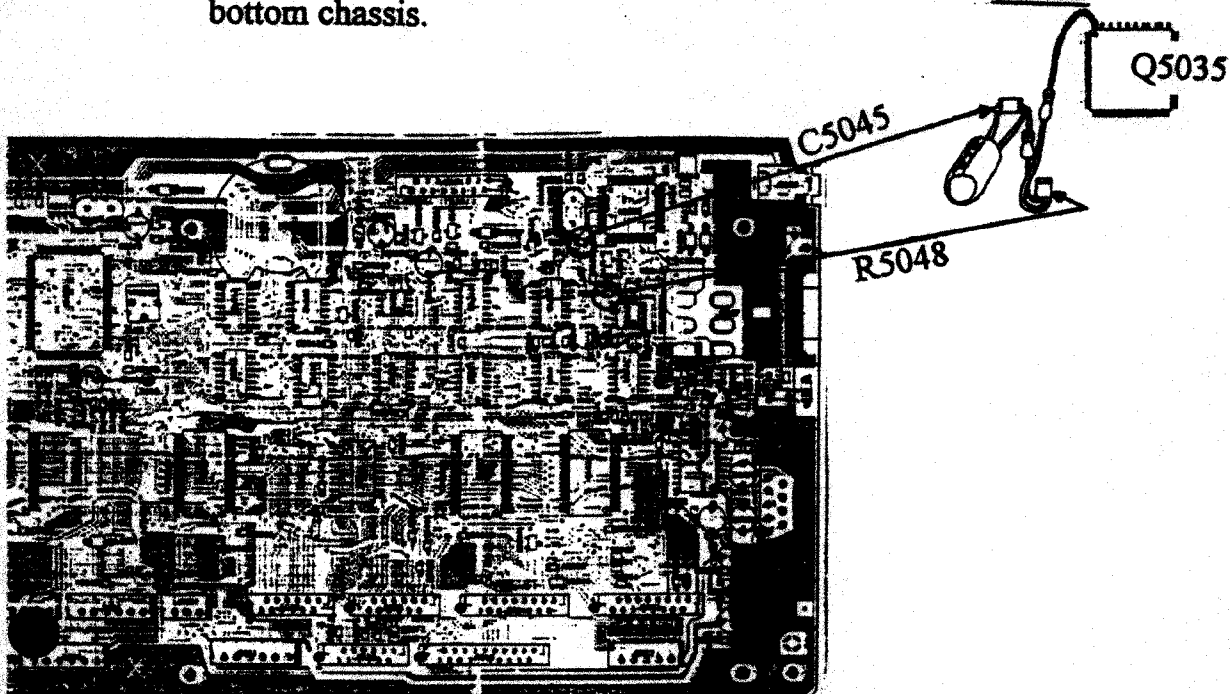

TECHNICAL BULLETIN

Yaesu U.S.A. - Amateur Products Division - Technical Support

File No.:	TB-9623 (2 of 2)	Date:	6-24-96
Model:	FT-1000MP	Serial No. Range:	Problem Unit

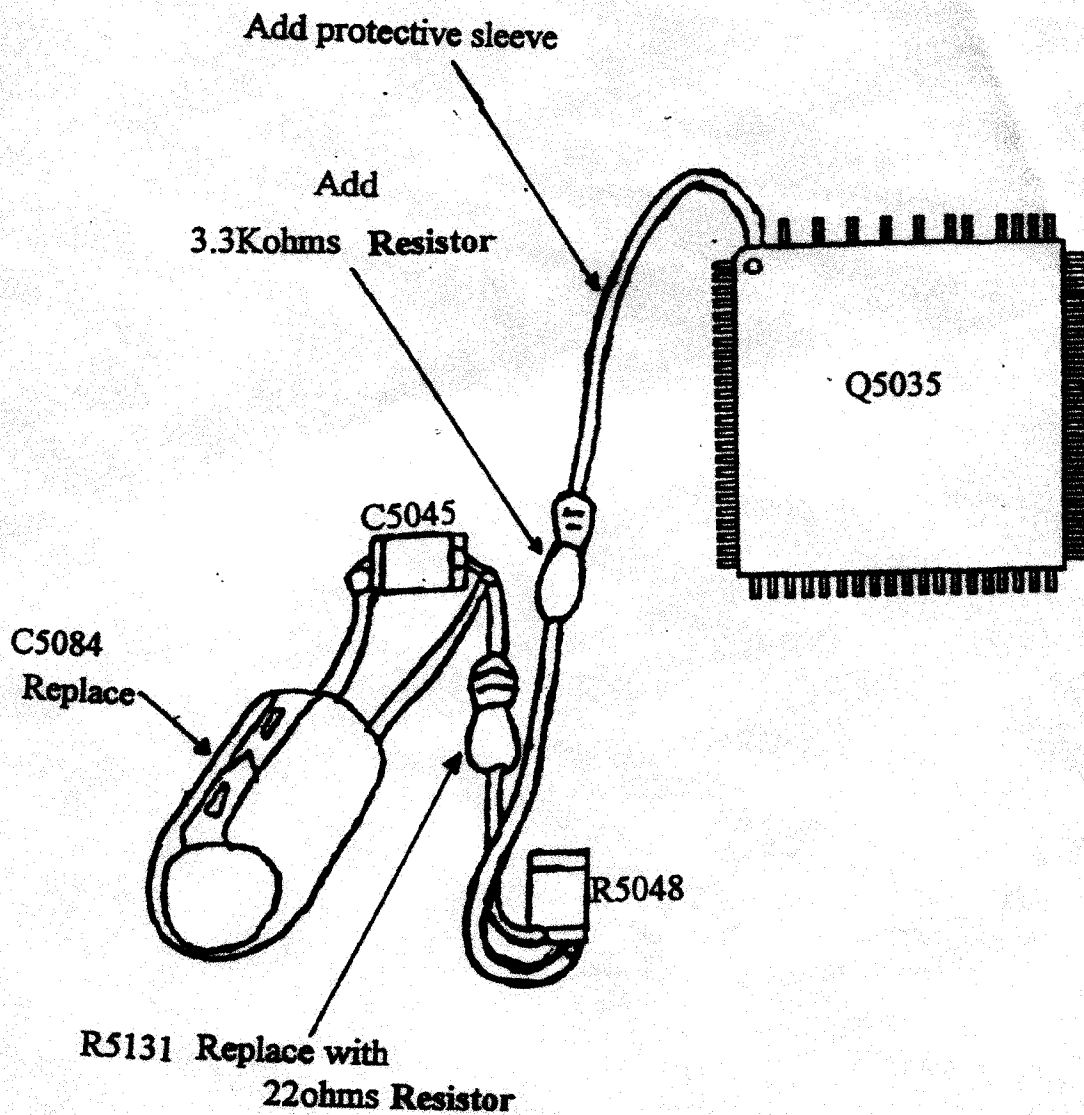

YAESU U.S.A., 17210 Edwards Road, Cerritos CA 90703 (310) 404-2700 Fax (310) 404-4828

J.D.